



①

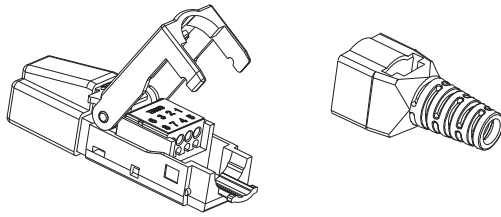

②


Insert cable into strain relief boot, strip off 1.2 inch of cable jacket, fold back braid and drain wire.

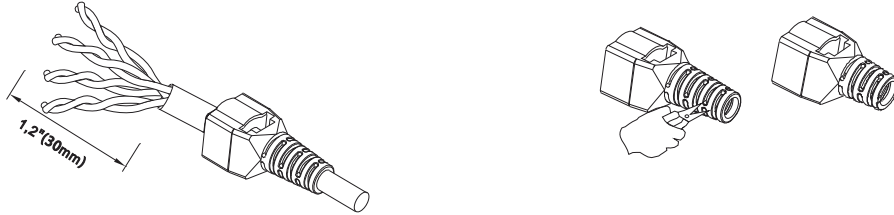

JACK PIN DESIGNATIONS	TIA/EIA T568B	
	1	White/Orange
	2	Orange
	3	White/Green
	4	Blue
	5	White/Blue
	6	Green
	7	White/Brown
8	Brown	


③

Fan out all four twisted pairs, following the color coding label and allocate each conductor into proper slots on wiring cap. Trim the ends of conductors.

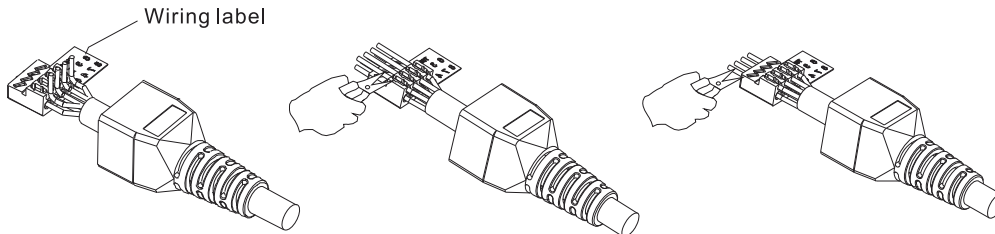


④

Place wiring cap on plug.

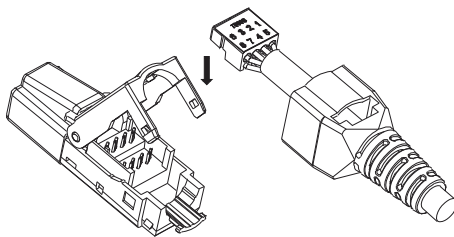


⑤

Place the wiring cap onto plug, use plier to clamp wiring cap until it completely snap-in to effect the connection.

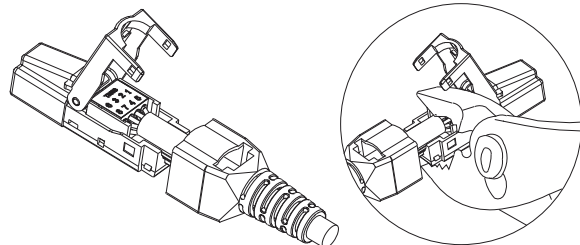

⑥

Close plug cover, make sure the drain wire is in proper contact with grounding clip on plug. Pull back strain relief boot to cover the plug, fasten supplied cable tie to secure grounding contact.

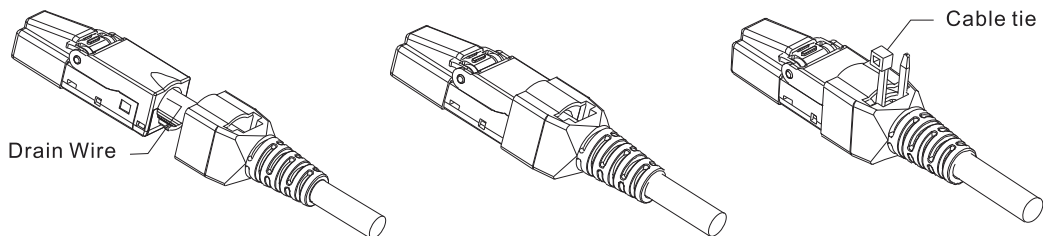

Unload the cable

Cut off cable tie, remove the boot. Using flat screw driver and pry gently on plug cover one end first and the other end subsequently to open it.

